



Apple iPhone 3G (8GB & 16GB variants)

Carrier: AT&T

Software tested: 2.0, 2.0.1

How to find the software version: On the Home screen touch **Settings → General → About**

Note: **BMW makes no guarantees or warranties as to the performance of each phone while connected to your BMW via Bluetooth® Wireless Technology. Furthermore, software releases by BMW, the phone supplier or the wireless carrier dated after testing might alter compatibility results.**

Vehicles compatible:

1-series
3-series
5-series
6-series
7-series
X3
Z4
X5

Produced after:

September 2005
September 2005
September 2004
September 2004
March 2005
September 2006
September 2006
September 2006

Pairing Instructions:

1. Set vehicle in pairing mode. For details please see the vehicle user's manual
2. On the Home screen touch **Settings → General → Bluetooth**
Your phone will display a list of any Bluetooth device(s) that it discovers in range and available to be paired




Select the name of the Bluetooth enabled device (e.g. BMW xxxx) with which you are pairing. Please note that the Bluetooth enabled device name may first appear as



- “Handsfree”.
3. Type in a 4-16 digit passkey on the cell phone first (on some BMW models like X3, Z4 and 7 series the passkey that is required for this step is fixed. See the car manual for the passkey. On all other cars the 4-16 digit passkey can be selected by the user). Touch "Connect"



4. Then the Confirm Passkey dialog appears in the display of the car:

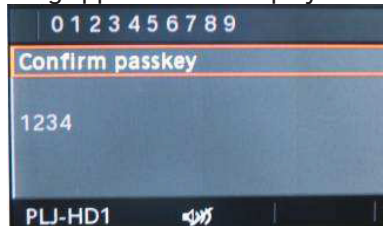

Repeat the passkey that was used on the device to authenticate the cell phone and press Confirm passkey.

Please note: If a different passkey is entered on the vehicle side, cell phone will displayed Passkey incorrect. If you try to reenter the correct passkey on the cell phone side, cell phone will still display Passkey incorrect and won't pair to vehicle.


To recover from this situation, Bluetooth has to be switched off on the cell phone and then switched back on. Then pairing process has to be restarted from the beginning.

To delete the device list from the phone, choose “Unpair”




Limitations:

1. **Accessory message pop-up**
All current BMW software levels have been approved before the availability of cell phone. The message has no effect on function and times out automatically after approx. 15 sec.

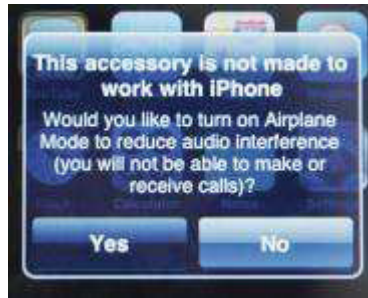

2. **iPod/USB adapter cable (Y-cable for connecting iPod/iPhone to the USB connector)**
The currently available cable will charge the iPhone with 100mA max (which is not detected by the iPhone and thus not indicated on the iPhone).
The revised y-cable for the iPhone charges with up to 500mA and the iPhone will indicate it's charging (available since mid August 2007)
3. **Accepting incoming calls at cell phone**
If user accepts an incoming call at the cell phone the call remains in privacy mode, but may be transferred to the car by touching the audio source button.

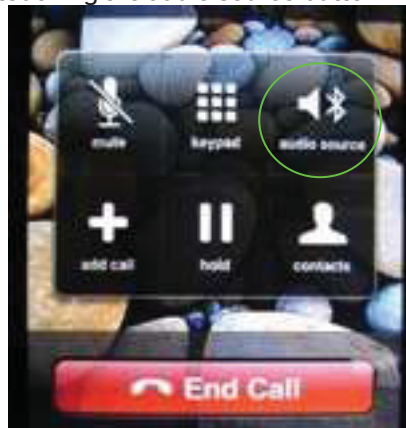

4. **Call waiting**
During a Bluetooth® hands free phone call, the hands free audio connection will be lost if a call waiting call is acknowledged via the handset. Please note: Bluetooth protocol does not support call waiting functions.
Scenarios:
 - During an active phone call, a second incoming call (call waiting call) is received and 'accept call' is selected. The communication menu shows the call time counter still counting and the radio remains muted for approximately 40 seconds. The second incoming call will be lost.
 - If first call is terminated via the vehicle when the handset has a second incoming call. The communication menu shows the call time counter still counting and the radio remains muted for approximately 40 seconds. The second incoming call will be lost.
 BMW of North America, LLC does not recommend using the handset to answer a call or switch between two calls while driving. There are two options to avoid this handset issue:
 - Call waiting can be disabled via the cell phone. To turn call waiting off, please go into Settings -> phone -> Call waiting and set it to off.
 - During an active phone call, if a second incoming call (call waiting call) is received to not 'accept' or 'reject' the second incoming.
5. **No entries from SIM card are transferred to car kit**
The telephone directory of the SIM card is not accessible over Bluetooth interface.



6. @-Symbol Character

On phonebook entries containing the @-symbol the @-symbol and following characters may not be transferred to the car.